Examination Control Division

2079 Ashwin

Exam.		Rank	
Level	BE	Full Marks	140
Programme	All except BEI, BAR and BCH	Pass Marks	16
Year / Part	I/II	Time	3 1


Subject: - Engineering Drawing II (ME 451)

- Candidates are required to give their answers in their own words as far as practicable.

 Attempt All questions.
 - The figures in the margin indicate Full Marks.
 - Necessary figures are attached herewith.
- Assume suitable data if necessary.

Draw an isometric drawing of an object with the orthographic views shown in figure below.

[10]

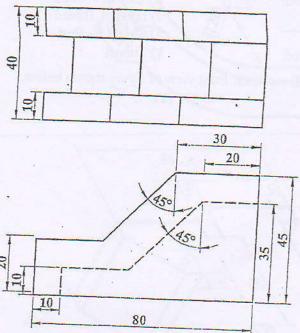

the perspective view of a cube of 25 mm edge, resting on ground with one of its likes. It has one of its vertical edges nearer to PP is 15 mm behind PP and all its vertical edges are equally inclined the picture plane. The station point is 55 mm in front of the three plane, 40 mm above the ground and lies in the central plane, which is 10 mm left the center of the cube.

[5]

Thole basis system] of 45 S6/h11. (FD. For S = -0.034, h = 0.000, value for ITG no. 6 12 are 16μm and 160μm respectively)

[5]

OR

butt joint.


[5]

2

variable

ower series

4. Draw the sectional front view of the given orthographic views.

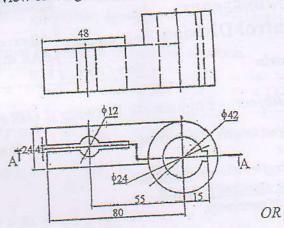


Sketch symbol of the followings:

- a) NPN Transistor
- c) Depression Contour
- e) Buzzer
- g) Elbow 90°
- i) Surface to be coated

- b) Fuse
- d) Circuit breaker
- f) Internal Thread
- h) Single V- Butt
- k) Tunnel

5. Draw the assembled full sectional front view of figure shown below. ***

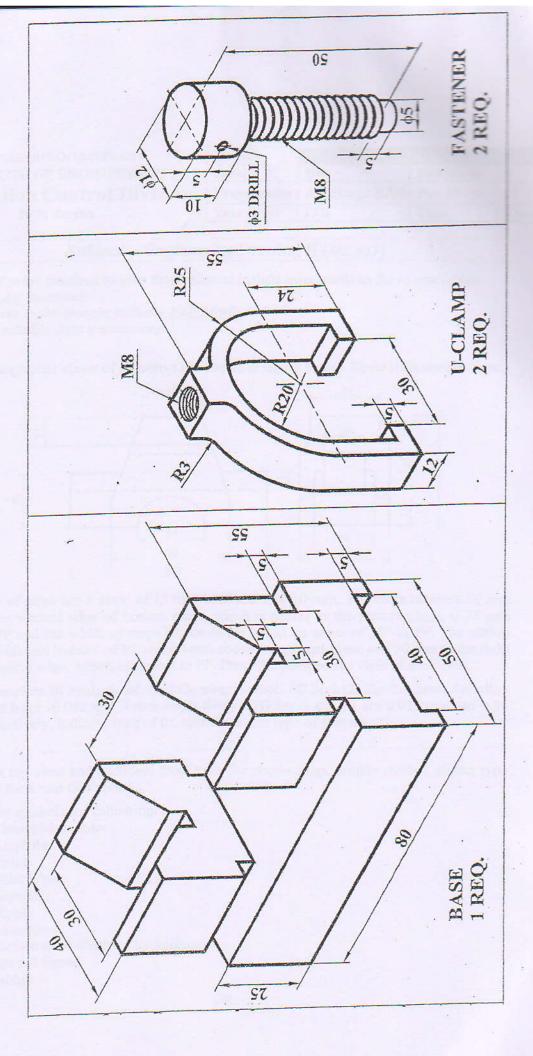

[15]

Examination Control Division 2079 Jestha

Exam.		Back ·	- 5
Level	BE	Full Marks	40
Programme	All except BAR	Pass Marks	16
Year / Part	I/II	Time	3 lars.

[10]

[6]


[5]

[5]

[5]

Subject: - Engineering Drawing II (ME 451)

- ✓ Candidates are required to give their answers in their own words as far as practicable.
- ✓ Attempt All questions.
- ✓ The figures in the margin indicate Full Marks.
- ✓ Assume suitable data if necessary.
- 1. The orthographic views of an object are shown in figure below. Draw its isometric view.

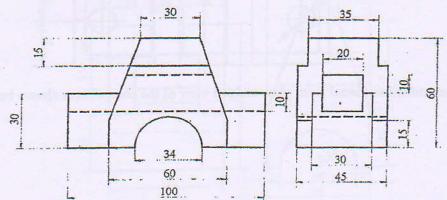

- A model of steps has 3 steps of 15 mm tread and rise 10 mm. The steps measure 50 mm wide. The vertical edge of bottom steps, which is nearer to the picture plane, is 25 mm behind PP and the width of steps recede to the left at an angle of 30° to PP. The station point is 100 mm in front of PP and 60 mm above the ground plane and 30 mm to the right of the vertical edge, which is nearest to PP. Draw the perspective view of the model.
- Make complete fit analysis of the following symbol: 60 S6/h12. Fundamental deviation for S and h are -0.042 and 0 mm respectively. ITG for 6 and 12 are 0.019 mm and 0.30 mm respectively. Indicate type of fit, allowance and type of system.


OR

Draw the top view and sectional front view for single strap, double riveted, zigzag type butt joint for 8 mm thick plate.

Sketch the symbols for following:

- a) Three phase motor
- b) Amplifier
- c) Union
- d) Fillet Weld
- e) Capacitor
- f) Nipple
- g) Ammeter
- h) Surface to be obtained by milling
- i) Internal thread
- j) Bridge

Draw sectional front view for the figure below.

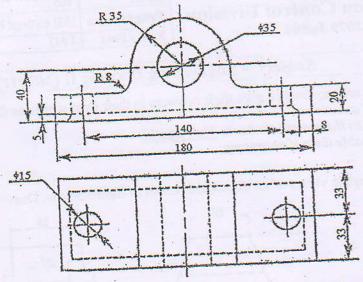

5. Draw assembled sectional front view and top view of the components shown below.

Examination Control Division

2078 Chaitra

Exam.	Regu	ar	22
Level	BE	Full Marks	40
Programme	BCE, BEL, BEX, BCT, BME, BAM, BIE, BAG, BGE, BAS	Pass Marks	16
Year/Part	1/11	Time	3 hrs.

Subject: - Engineering Drawing II (ME 451)

Candidates are required to give their answers in their own words as far as practicable.


√ Attempt All questions.

✓ The figures in the margin indicate Full Marks.

✓ Necessary figures are attached herewith.

✓ Assume suitable data if necessary.

1. Draw an isometric of a solid according the two plane projection of a solid shown in figure below.

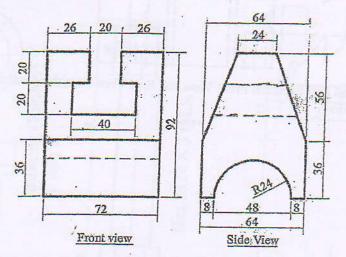

- 2. A hexagonal base prism of side length 25 mm and height 50 mm rests with its base on the ground with one of its faces inclined at 30° to the picture plane and the nearest vertical edge is 12 mm behind the PP. The station point is 45 mm in front of PP and 60 mm above the ground and 15 mm left to the nearest vertical edge to the PP. Draw the perspective projection of prism.
- 3. Determine the limits of dimensions and type of fit designated by 80 D9/h8, assuming fundamental deviation for D and h respectively as 32 µm and 0 µm above the basic size line and international tolerance grades for 8 and 9 as 34 µm and 42 µm respectively.

OH

Sketch the top view and sectional front view of double strap, double row zig-zag type riveted butt joint. Take thickness of sheet 9 mm.

4. Draw the standard symbols of following different engineering field:

[5]

[6]


[5]

[10]

- a) Mosque
- b) River stream
- c) Cotton field
- d) Railway track
- e) Relief valve
- f) Rheostat
- g) Ammeter
- h) Single V-butt joint
- i) C-channel
- i) Surface roughness


...

Draw auxiliary sectional view of the object shown in below figure.

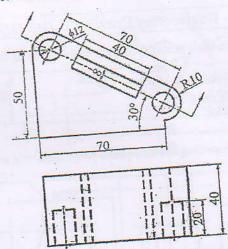

 Draw the assembled Full Sectional Front View and Side View from the detailed drawings shown in figure below.

[14]

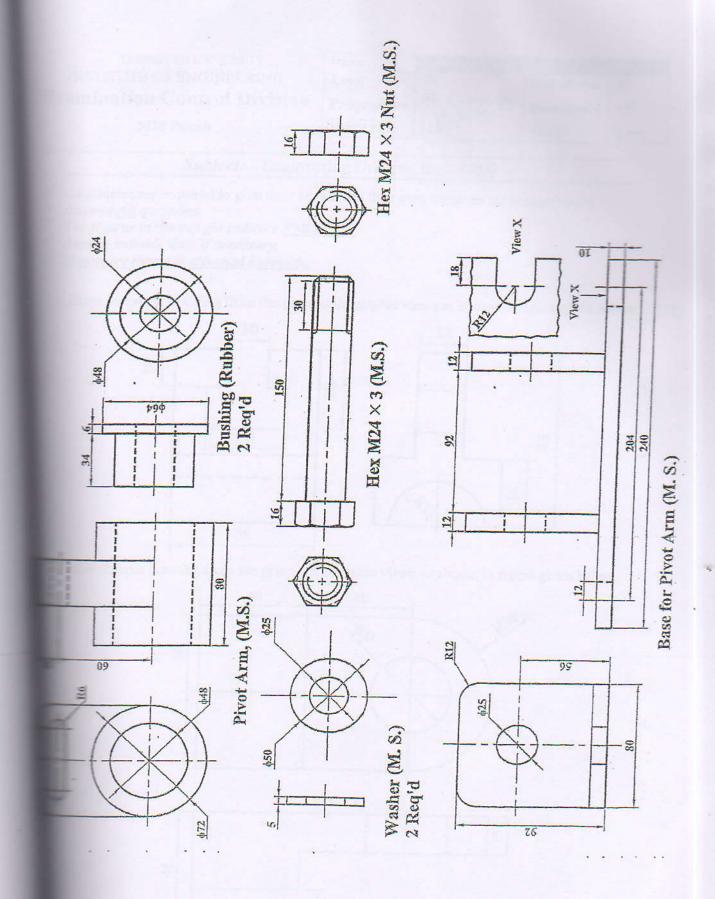

Tramination Control Division

2078 Poush

Exam.		Back	#2. ·
Level	BE	Full Marks	40
Programme	All (Except BEI, BAR, BCH)	Pass Marks	16
Year / Part	1/11	Time	3 hrs.

Subject: - Engineering Drawing II (ME 451)

Candidates are required to give their answers in their own words as far as practicable.


Attempt All questions.

The figures in the margin indicate Full Marks.


Assume suitable data if necessary.

Necessary figure is attached herewith.

Draw isometric drawing from the given orthographic views as shown in figure given below. [10]

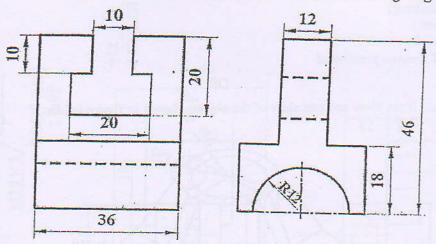

Draw oblique drawing from the given orthographic views as shown in figure given below

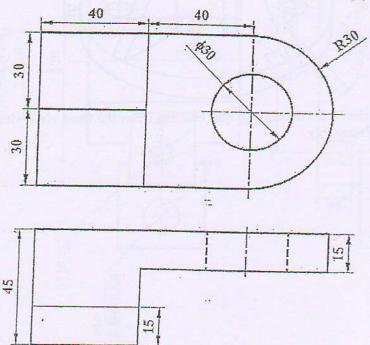

3. Sketch the top view and sectional front view of double riveted, double strap chain butt joint.


OR

Determine the limits of dimensions and type for fit designated by H8c11 for the basic size of 50 mm, assuming fundamental deviation for H and c respectively as 0 μ m above the basic size line and 125 μ m below the basic size line and international tolerance grades for 8 and 11 as 39 μ m and 110 μ m.

- 4. Draw the standard symbols for the following:
 - a) School
 - b) Single V-butt joint
 - c) Thermocouple
 - d) LED
 - e) Microphone
 - f) Socket outlet
 - g) Tee (plumbing)
 - h) Amplifier
 - i) Cap
 - j) Material remove prohibited

OR


Draw sectional front view and top view of the objects shown in figure below.

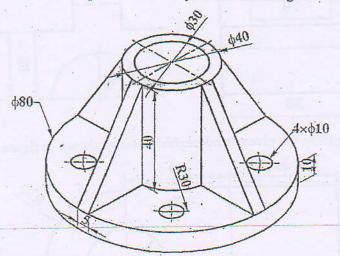

The attached figure shows the details of a split bearing. Draw the front view with section and side view of the assembly.



[14]

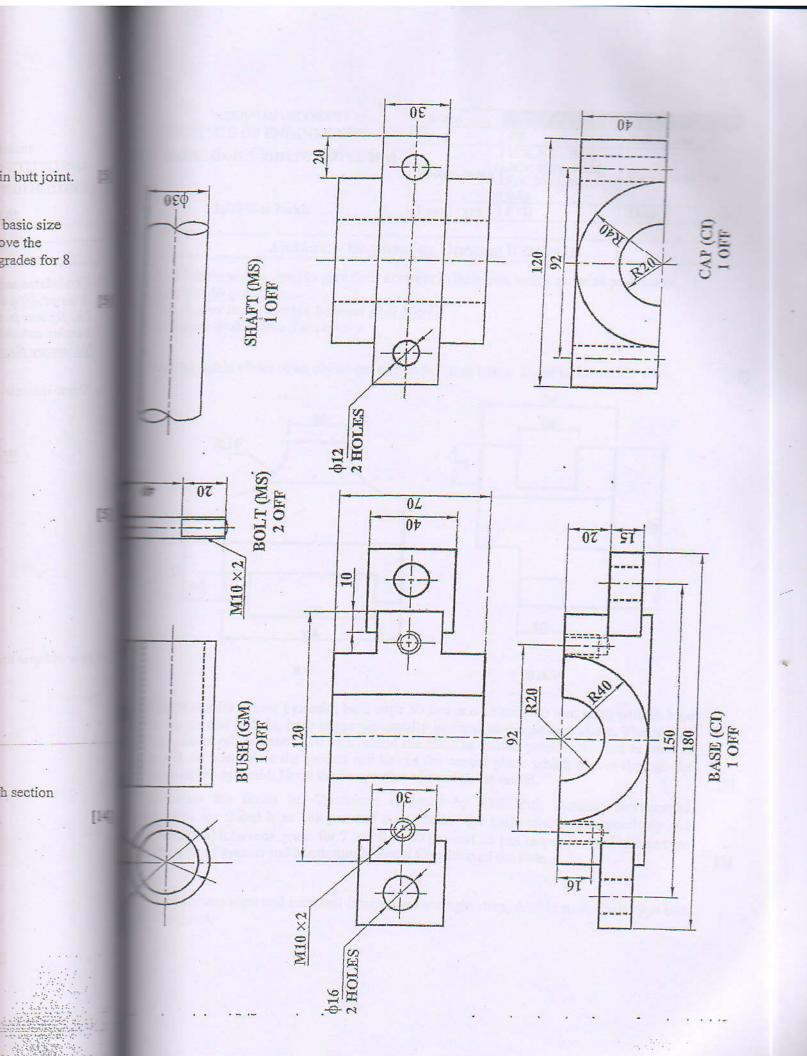

Examination Control Division

			Our -			
20	70	T -	-		Y.,	L
/ 41	1.76	- 0		11.7	M.	а

Exam.	В	ačk	
Level ·	BE	Full Marks	40
Programme	BCE, BEL, BEX, BCT, BME, BAM, BIE, BAG, BGE, BAS	Pass Marks	16
Year / Part	I/II	Time	3 hrs.

[10]

[5]

[5]

Subject: - Engineering Drawing II (ME 451)


Candidates are required to give their answers in their own words as far as practicable.

Attempt All questions.

The figures in the margin indicate <u>Full Marks</u>.

Assume suitable data if necessary.

Orthographic views of an object are shown in figure below. Draw its isometric view.

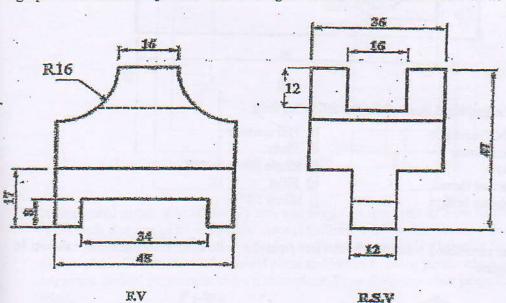


- A right regular square pyramid, base edge 30 mm and altitude 40 mm rests with its base on the ground and the base edges are equally inclined to the picture plane. The nearest front corner of the base is 10 mm behind the PP. The station point is 45 mm in front of the PP, 60 mm above the ground and lies in the central plane which passes through the vertex of the pyramid. Draw the perspective view of the pyramid.
- Determine the limits of dimensions designed by 180S7/h6. Assume fundamental deviation for S and h as 108 µm and 0 µm below the basic size line respectively and international tolerance grade for 7 and 6 as 40 µm and 25 µm respectively. Indicate type of fit, type of system and Maximum Material Condition of the hole.

OR

Exetch the top view and sectional front view for single strap, double row, chain type butt exeted joint.

4. Draw the sectional front view (section at A-A) as shown in figure below.

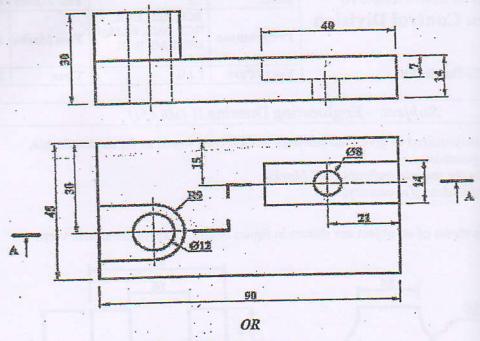


Sketch the graphical symbol for the following item.

- a) NPN Transistor
- c) Transformer
- e) Elbow
- g) External thread i) Highway bridge

- b) Hill contour
- d) Siren
- f) Single phase motor
- h) Fillet
- j) Elbow 90°

5. Draw the assembled sectional front view from the following detail drawings shown below figure.

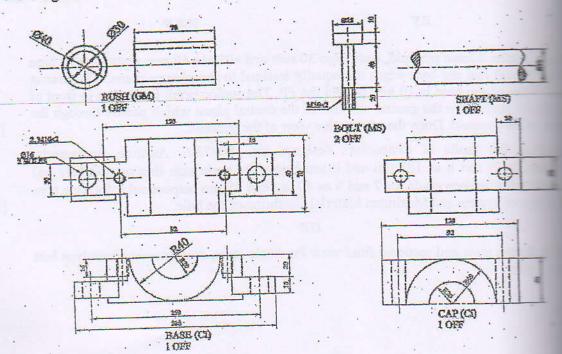

[5]

shown in

FT (MS)

[15]

TRIBHUVAN UNIVERSITY INSTITUTE OF ENGINEERING

Examination Control Division

2077 Chaitra

Exam.	Regu	lar 🤺	
Level	BE .	Full Marks	40
Programme	BCE, BEL, BEX, BCT, BME, BAM, BIE, BAG, BGE, BAS	Pass Marks	16 -
Year / Part	1/11	Time	3 hrs.

[10]

[5]


151

Subject: - Engineering Drawing II (ME451)

✓ Candidates are required to give their answers in their own words as for as practicable.


√ Attempt All questions.

- √ The figures in the margin indicate Full Marks.
- √ Assume suitable data if necessary.
- 1. Draw an isometric view from the orthographic views as shown in figure below. Show dimensions as well.

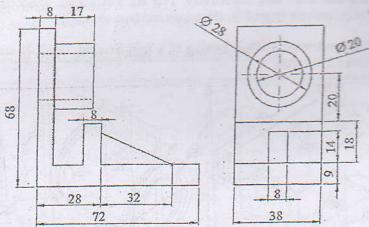

2. A hexagonal prism, side of base 25 mm and height 50 mm with its base on the ground plane such that one of its rectangular faces is inclined at 30° to the picture plane and the vertical edge nearer to PP'is 15 mm behind it. The station point is 45 mm in front of the picture plane, 70 mm above the ground plane and lies in a central plane, which is 15 mm left to the vertical edge nearer to the picture plane. Draw the perspective projection of the prism.

3. Orthographic projections of the object are shown in figure below. Draw the full sectional top view of the object.

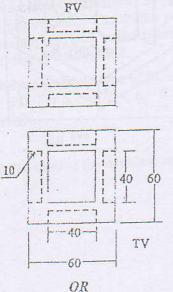

Draw the standard symbols for the following.


- a) Spot Weld
- c) Thermocouple
- e) Circuit Breaker
- g) Church
- i) Buzzer

- b) Globe valve
- d) Surface produced by lapping
- f) Solid shaft
- h) Meadow
- j) Telephone-Telegraph line
- 4. Sketch the top view and sectional front view for double row zig-zag type lap riveted joint.

OR

Make complete fit analysis of the following symbols 100H7/s6. F.D. for H and s are 0.000 mm and 0.071 mm respectively. ITG for 7 and 6 are 0.035 mm and 0.022 mm respectively. Indicate type of fit, allowance and type of system.

5. Figure below shows the detail drawing of a Split Bearing. Draw its assembled top view and sectional front view.

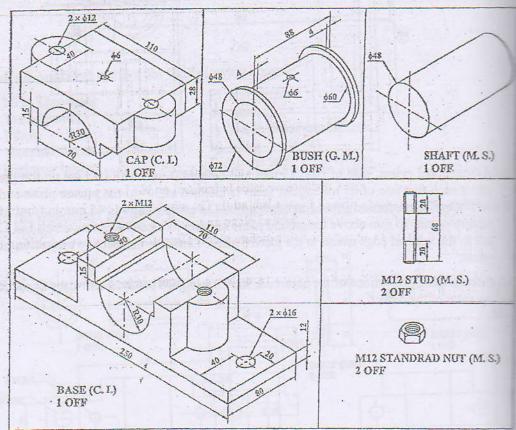

TE OF ENGINEERING

tion Control Division

2076 Baishakh

$_{ m c}$, $_{ m c}$	Back	
BE	Full Marks	40
All (Except BAR)	Pass Marks	16
I/II	Time	3 hrs.
	All (Except BAR)	All (Except BAR) Pass Marks

[10]

[5]

[5]


Subject: - Engineering Drawing II (ME 451)

are required to give their answers in their own words as far as practicable.

All questions.

res in the margin indicate <u>Full Marks</u>. mitable data if necessary.

isometric drawing of an object with the orthographic views shown in figure

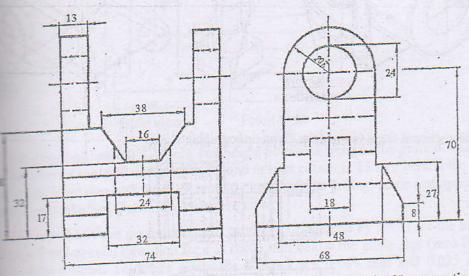

pentagonal base pyramid of 25 mm base side and axial height 65 mm resting on base, one side of base is inclined to picture plane at 30° to right side, one nearest of base is 20 mm behind the picture plane. The station point is 50mm in front of plane and 75 mm above ground plane and center plane lies 15 mm left to the corner. Draw the perspective view of the Pyramid.

and make the complete fit analysis [Indicate type of fit, allowance and shaft basis basis system] of 45 S6/h12. (FD. For S = -0.034, h = 0.000, value for ITG no. 6 are 0.016 and 0.160 respectively)


OR

Example 2 Sectional Front view and Top view of the double riveted, double strap, zig-zag [5]

ap riveted joint.

or H and s are and 0.022 mm

mbled top view




1 OFF

TUD (M. S.)


20



4. Draw the assembled full sectional front view of a universal coupling shown in figure below.

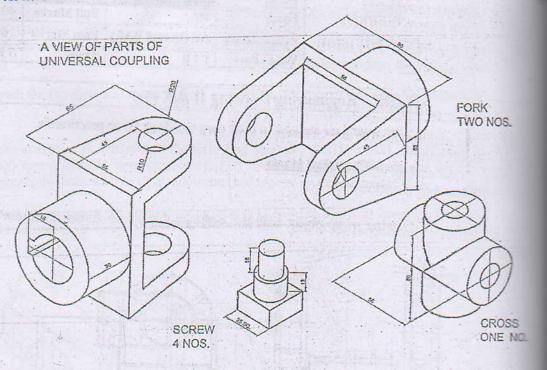

5. Draw the sectional front view of the given orthographic views.

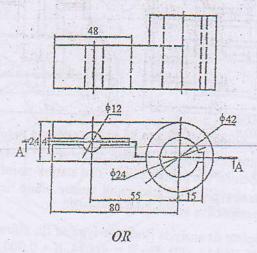

Sketch symbol of the followings:

a. Depression Contour	b. School
c. Surface to be coated	d. Check Valve
e.Depression Contour	f. School
g. Surface to be coated	h. Check Valve
i. Depression Contour	j. School

Examination Control Division 2075 Bhadra

Exam.	Regular		
Level	BE	Full Marks	40
Programme	All (Except B.Arch.)	Pass Marks	16
Year / Part	I/II	Time	3 hrs.


[10]

[5]

[5]

Subject: - Engineering Drawing II (ME451)

- ✓ Candidates are required to give their answers in their own words as far as practicable.
- ✓ Attempt All questions.
- ✓ The figures in the margin indicate Full Marks.
- ✓ Assume suitable data if necessary.
- 1. Draw an Isometric view of a solid, referring the front and side view shown in figure below.

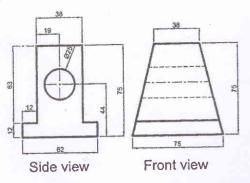


- 2. A square base prism of base 40 × 40 mm and height 60 mm is lying in the ground. One of its side of base make angle 30 degree with PP and nearest corner is 15 mm behind the PP. The station point is 60 mm in front of PP and 80 mm above the ground plane and opposite to the nearest vertical edge. Draw its perspective view.
- 3. Determine the type of fit and maximum metal condition designated by H8/f7 for the basic size of 30mm. Fundamental deviation for f is 0.003 mm below the basic size (zero line) respectively. International Tolerence grade for 8 and 7 are 0.039 mm and 0.025 mm respectively.

OR

Draw the sketch the top view and sectional front view for double row double strap riveted joint for 10 mm thick iron plate finding the diameter of rivet.

[15]

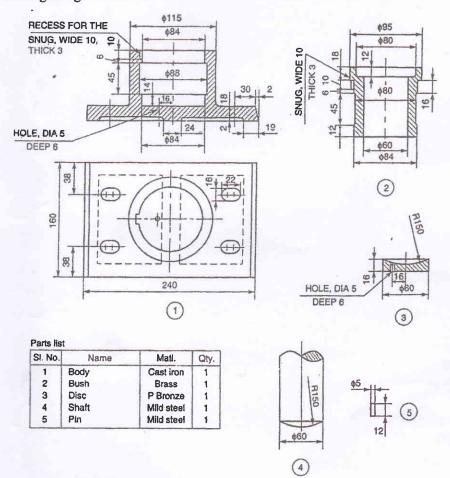

5. Sketch the sectional Front view of figure below.

OR

Sketch the graphical symbol for following item.

- a) NPN Transistor
- c) Hill Contour
- e) Siren
- g) Elbow 90°
- i) Surface to be obtained by filing
- b) Transformer
- d) Single phase motor
- f) Internal Thread
- h) Fillet
- k) Highway bridge


[5]

Examination Control Division 2075 Baishakh


Programme	Will (Threeh.	1	2 1 400
	T/II	Time	3 nrs.
Year / Part	1/11		

Subject: - Engineering Drawing II (ME451)

- ✓ Candidates are required to give their answers in their own words as far as practicable.
- Attempt All questions.
- ✓ The figures in the margin indicate Full Marks.
- ✓ Assume suitable data if necessary.
- 1. Draw an isometric view from the given orthographic views as shown in figure below:

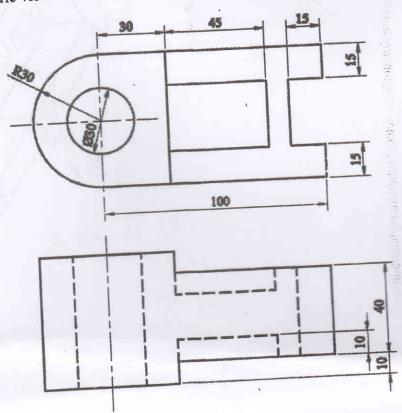


2. Draw the angular perspective view of figure below:

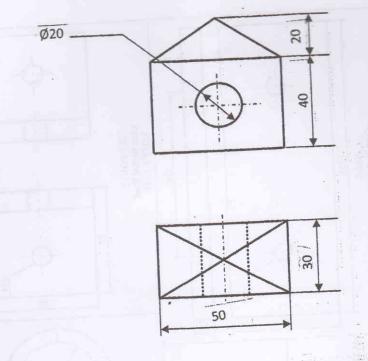

[5]

[10]

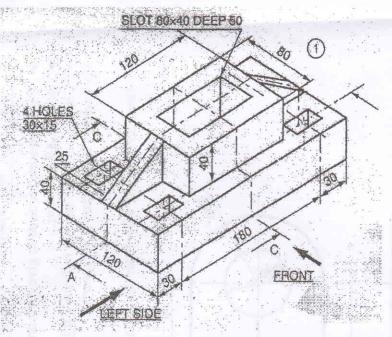

OR

Draw the standard symbols for the following:

- a) External Thread
- b) First angle projection
- c) Projection welding
- d) Nipple
- e) Material removed by milling
- f) Maximum material condition
- g) Thermistor
- h) Three phase motor
- i) Channel
- i) Church
- 4. Sketch the top view and sectional front view for double riveted double strap chain butt joint.


[5]

OR

Make complete fit analysis of the following symbols 100H11/p7; fundamental deviations for H and p are 0.00 mm and 0.037 mm respectively. ITG for 11 and 7 are 0.22 mm and 0.035 mm respectively. Indicate type of fit, allowance and type of system.

Draw the assembled sectional front view from the following detail drawings shown in figure below.

[15]

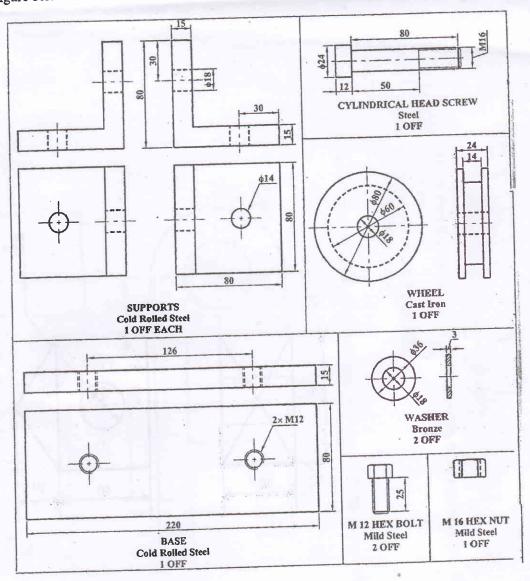

Examination Control Division 2074 Bhadra

Exam.	Reg	ular	
Level	BE	Full Marks	40
Programme	All (Except B. Arch)	Pass Marks	16
Year / Part	I/II	Time	3 hrs.


[10]

[5]


[5]

Subject: - Engineering Drawing II (ME451)

- Candidates are required to give their answers in their own words as far as practicable.
- ✓ Attempt <u>All</u> questions.
- ✓ The figures in the margin indicate Full Marks.
- ✓ Necessary figures are attached herewith.
- ✓ Assume suitable data if necessary.
- 1. Orthographic views of an object are shown in figure below, Draw its isometric view.

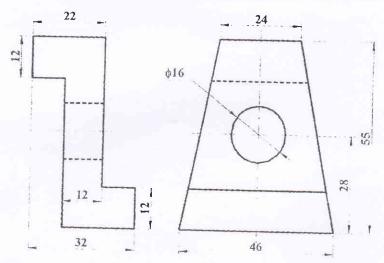

- 2. A solid square prism of side base 30 mm and height 40 mm rests with its base on the ground and one of the rectangular faces inclined at 30 degree to the PP. the nearest vertical edges touches the pp. the Station point is 80 mm in front of the pp, 80 mm above the ground and opposite to the nearest vertical edge that touches the pp. Draw the perspective view and indicate main dimensions.
- 3. Draw sectional front view from the component as shown in figure below.

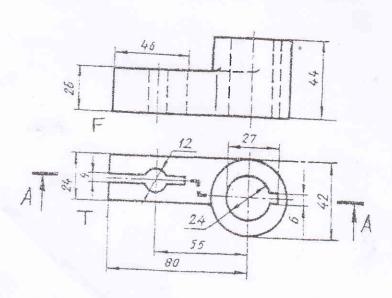

4. Draw the front view and full sectional top view of double riveted double strap chain type butt joint.


OR

Determine the limits of dimensions and types of fit designed by 50H8/d9. Assume fundamental deviation for H and d as 0 micrometers above the size and 0.080 mm below the basic size line respectively and international tolerance grade for 8 and 9 as 0.039 mm and 0.062 mm respectively.

5. Draw the assembled sectional front view from the detail drawing in figure 5 (attach with Question)

[15]

[5]

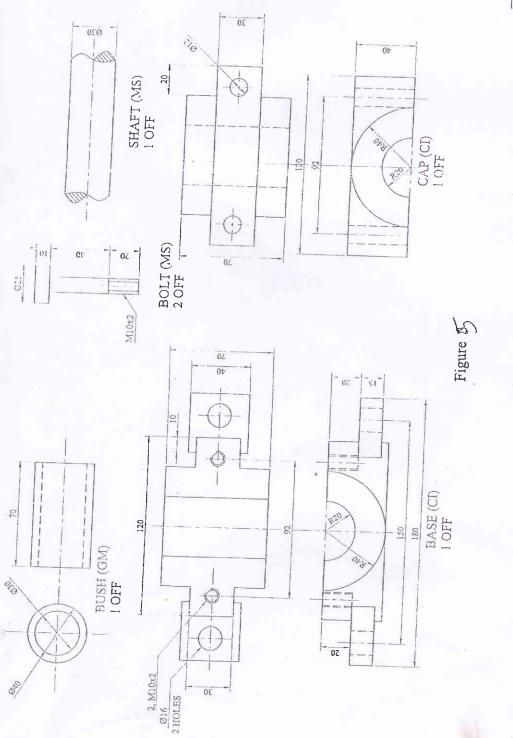


Examination Control Division 2073 Magh

Exam.	New Back (2066 & Later Batch)		
Level	BE	Full Marks	40
Programme	All (Except B. Arch)	Pass Marks	16
Year / Part	I/II	Time	3 hrs.

Subject: - Engineering Drawing II (ME451)

- ✓ Candidates are required to give their answers in their own words as far as practicable.
- ✓ Attempt All questions.
- ✓ The figures in the margin indicate Full Marks.
- ✓ Assume suitable data if necessary.
- 1. Draw an isometric view from the given orthographic views as shown in figure 1.



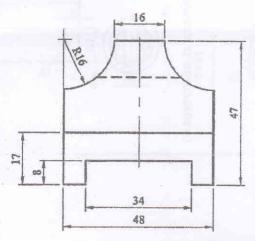

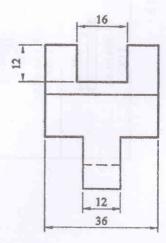


Figure 1

2. A model of steps has 3 steps of 15mm tread and rise 10mm. The steps measure 60mm wide. The vertical edge of bottom step, which is nearer to the picture plane, is 25mm behind PP and the width of steps recede to the left at an angle of 30° to PP. The station point is 100 mm in front of PP and 60 mm above the ground plane and 30 mm to the right of the vertical edge, which is nearest to PP. Draw the perspective view of the model.

[6]

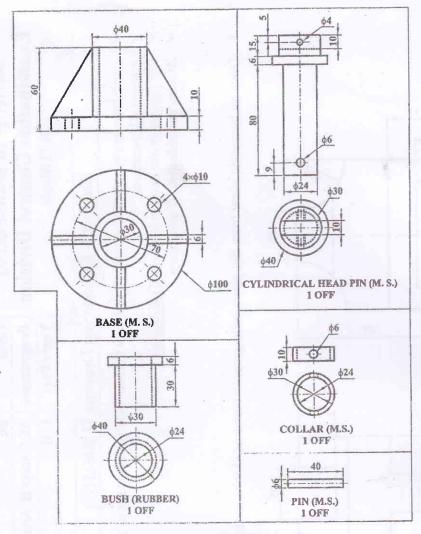


Figure 3

4. Sketch the top view and sectional front view for double row, single strap, chain type butt riveted joint.

OR

Make complete fit analysis of the following symbols 60S6/h12.F.D. for S and h are 0.042 mm and 0.00 mm respectively. ITG for 6 and 12 are 0.019 mm and 0.30 mm respectively. Indicate type of fit, allowance and type of system.

[5]

5. Draw removed or rotated section at A-A and B-B from the components as shown in figure 5.

[5]

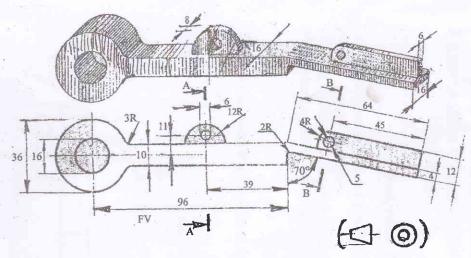


Figure 5

Sketch the symbol of following Items

- a) Material removed by milling
- b) 90° Elbow
- c) Maximum Material Condition
- d) Gumba
- e) River

- OR
- (f) Transistor (g) Capacitor
- (h) Stud
- (i) External Thread
- (j) Lap Weld


Examination Control Division

2073 Bhadra

Exam.	Regular		
Level	BE	Full Marks	40
Programme	All (Except B.Arch.)	Pass Marks	16
Year / Part	I/II	Time	3 hrs.

Subject: - Engineering Drawing II (ME451)


- ✓ Candidates are required to give their answers in their own words as far as practicable.
- ✓ Attempt <u>All</u> questions.
- ✓ The figures in the margin indicate Full Marks.
- ✓ Assume suitable data if necessary.
- 1. Orthoghraphic views of an object is shown in figure below. Draw its isometric view.

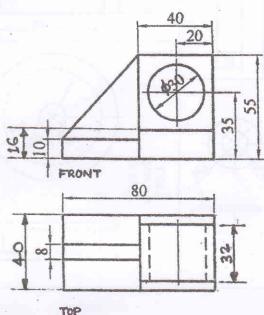

2. A right regular square pyramid, base edge 30 mm and altitude 40 mm rests with its base on the ground and the base edges are equally inclined to the picture plane. The nearest front corner of the base is 10 mm behind the PP. The station point is 45 mm in front of the PP, 60 mm above the ground and lies in the central plane which passes through the vertex of the pyramid. Draw the perspective view of the pyramid.

[10]

3. Draw the assembled sectional front view from the following detail drawings shown in figure below. [14]

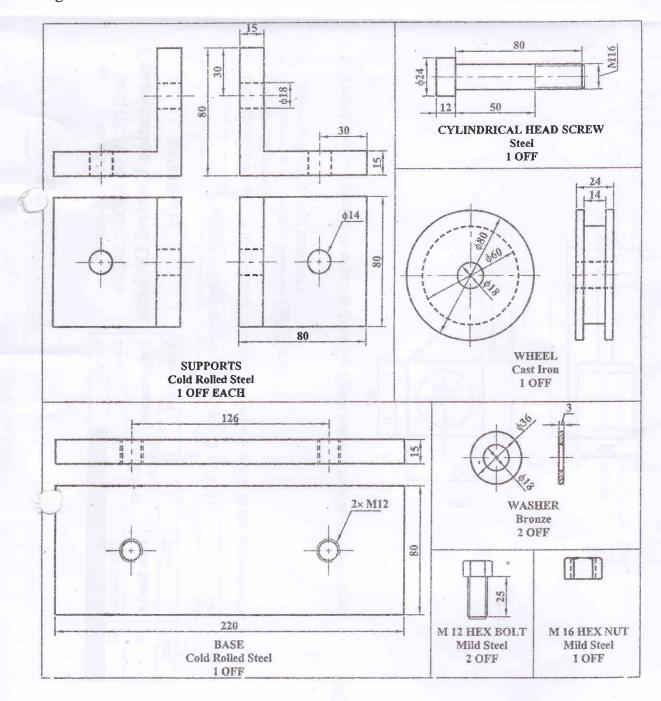

4. Sketch top view and sectional front view of single riveted double strap butt joint.

[5]


OR

Determine the limits of dimensions and types of fit designed by 100 H7/s6. Assume fundamental deviation for H and s as 0 micrometers and 0.080 mm above the basic size line respectively and International tolerance grade for 7 and 6 as 0.035 mm and 0.022 mm respectively.

[5]

5. Orthographic projection of the object is shown in figure below. Draw the sectional view at section A-A.

[5]

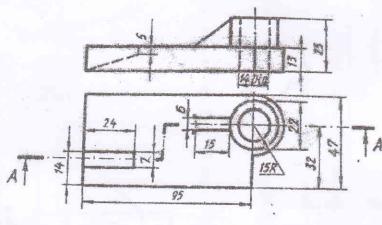

OR

Draw the standard symbols for the following.

- a) Internal Thread
- c) Spot weld
- e) Surface to be obtained by fine turning
- g) Rectifier
- i) I beam

- b) Third angle projection
- d) Expansion joint
- f) Least material condition
- h) Loud speaker
- j) School

**:

Examination Control Division


2071 Bhadra

Exam.	Regular / Back		
Level	BE	Full Marks	40
Programme	All (Except B.Arch.)	Pass Marks	16
Year / Part	I/II	Time	3 hrs.

Subject: - Engineering Drawing II (ME451)


- ✓ Candidates are required to give their answers in their own words as far as practicable.
- ✓ Attempt All questions.
- ✓ The figures in the margin indicate Full Marks.
- ✓ Assume suitable data if necessary.
- 1. From the given front and side view of a solid draw the isometric view.

[10]

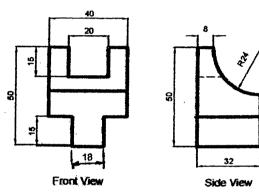

2. Draw oblique drawing from the given orthographic views as shown in figure below.

[5]

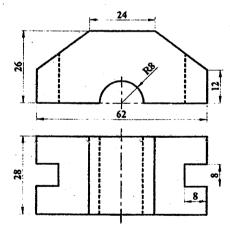


3. Determine the limit, tolerance, allowances and type of fit for 50 H7/p6. The value of fundamental deviation given by H is zero and p is above the basic line and value is 0.032 mm, and international tolerance given by 7 is 0.025 and 6 is 0.016 mm respectively.

[4]

OR

Draw the top view and sectional front view of double row zig zag type riveted single strap butt joint for 8 mm thick plate.


4. Figure below shows the details of a split bearing. Draw the assembled front view with section. Take any length for the shaft.

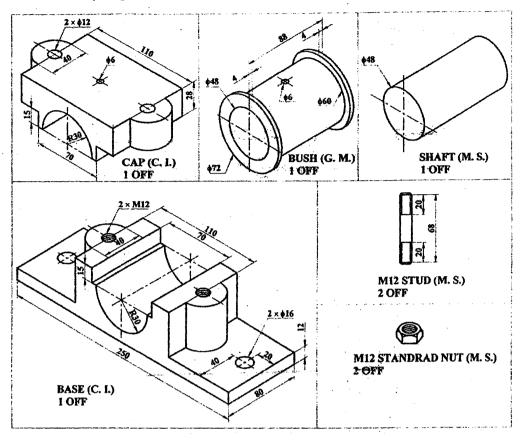

- 5. Draw the standard symbols for the following:
 - a) Surface to be obtained by fine turning
 - b) Gate valve
- c) Tee
- e) Thermocoupleh) Circular tube
- f) DC Motor
- i) Fuse
- d) Reducer
- g) Transformer
-) Speaker

Orthographic views of a forked end of a machine part are shown in figure below. Draw its sectional front view (Section B-B).

OR

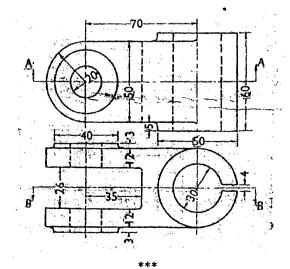

[5]

[16]

Examination Control Division

2071 Magh

Exam.	New Back (2066 & Later Batch)		
Level	BE	Full Marks	40
Programme	All (Except B.Arch.)	Pass Marks	16
Year / Part	I/II	Time	3 hrs.

Subject: - Engineering Drawing II (ME451)

- Candidates are required to give their answers in their own words as far as practicable.
- ✓ Attempt All questions.
- ✓ The figures in the margin indicate Full Marks.
- ✓ Necessary figures are attached herewith.
- ✓ Assume suitable data if necessary.
- 1. Orthographic views of an object are shown in Figure P.1. Draw its isometric view.

[9]

2. A cylinder having 70 mm diameter and 40 mm height is surmounted by a square pyramid having side 35 mm and height 50 mm. Draw the angular perspective projection when one of the side of pyramid is 30° inclined and its nearest corner is 30 mm behind the projection plane. Take station point 35 mm in front of projection plane, 25 mm left of nearest corner and 110 mm above the ground level.

[6]

3. Sketch the top view and sectional front view of double row, single cover zig zag Butt joint.

[5]

OR

Sketch the symbols for the following

[5]

- a). Spot weld

f) Hand set

b) Internal thread

Temple

c) Fan regulator

- Material removed by turning
- d) 3-phase transformer
- Rapids

e) Circuit breaker

- i) Perpendicular lay
- 4. The assembly drawing of Hand Vice is shown in Figure P.4. Draw detail drawing of each component. Assume suitable thickness if necessary. Part list is given below.

[15]

Part List

X 774 T 22 10 T			
SN	Part Name	Part No.	Quantity
1	Body	1	1
2	Screw	2	1
3	Screw Base	3	1
4	Handle	4	1
5	Handle end	5	2
6	Pin .		. 2

5. Determine limits, tolerance, allowance and types of fit designated by 80 D9/h8. The fundamental deviation of hole is 0.032 mm more than fundamental deviation of shaft. International tolerance grades for 8 and 9 are 0.034 mm and 0.042 mm respectively.

[5]

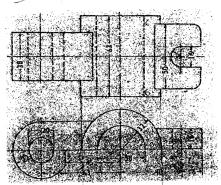


Figure P.1

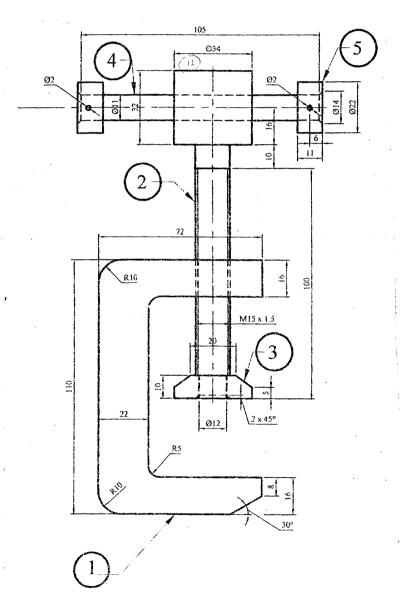



Figure P.4


Examination Control Division 2071 Magh

Exam.	OLD Back (2065 & Earlier Batch)		
Level	BE	Full Marks	40
Programme	BEL, BEX, BCT, BME, BIE	Pass Marks	16
Year / Part	I / II	Time	3 hrs.

Subject: - Engineering Drawing II (EG481ME)

- ✓ Candidates are required to give their answers in their own words as far as practicable.
- ✓ Attempt <u>All</u> questions.
- ✓ The figures in the margin indicate Full Marks.
- ✓ Assume suitable data if necessary.
- 1. Draw isometric drawing from the given orthographic views as shown in Figure P.1.
- 2. Draw oblique drawing from the given orthographic views as shown in Figure P.2.

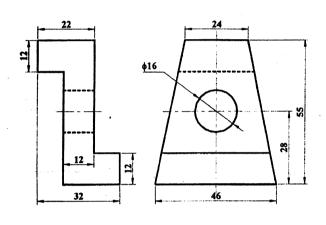

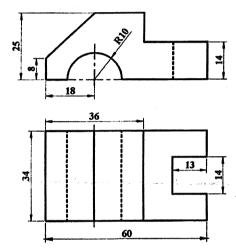

[10] [6]

[5]

[5]

Figure P.1

Figure P.2

3. Sketch the top view and sectional front view of single riveted, double strap butt joint.

OR

Determine the limits of dimensions and type for fit designated by H8/c11 for the basic size of 50 mm, assuming fundamental deviation for H and c respectively as 0 μ m above the basic size line and 125 μ m below the basic size line and international tolerance grades for 8 and 11 as 39 μ m and 110 μ m.

- 4. Draw the standard symbols for the following:
 - (a) Union
 - (b) Transformer
 - (c) Circular tube
 - (d) Fuse
 - (e) Elbow
 - (f) Hill Contours
 - (g) Butt weld
 - (h) Coated surface
 - (i) Speaker
 - (j) Internal thread (any view)

Draw the assembled front view with section from the following detail drawings shown in 5. Figure P.5.

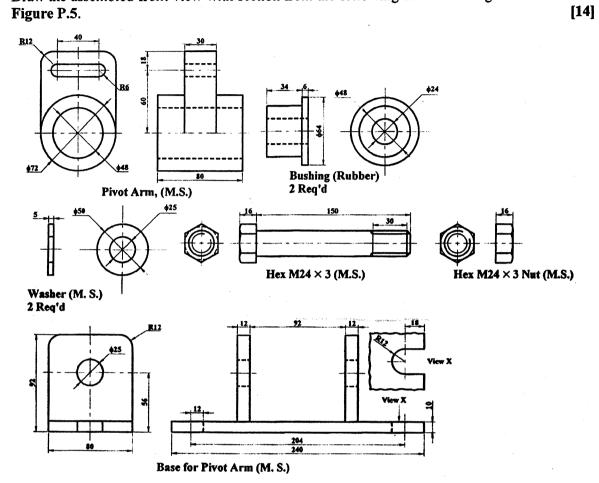


Figure P.5

Examination Control Division


2070 Magh

Exam.	New Back (2066 & Later Batch)		
Level	BE	Full Marks	40
Programme	All (Except B.Arch)	Pass Marks	16
Year / Part	1/11	Time	3 hrs.

Subject: - Engineering Drawing II (ME451)

- Candidates are required to give their answers in their own words as far as practicable.
- Attempt All questions.
- The figures in the margin indicate Full Marks.
- Assume suitable data if necessary.
- 1. Draw Isometric drawing of the object shown by figure below.

[10]

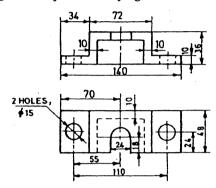

- 2. A square prism of base 30 mm×30 mm base and height 50 mm is lying in the ground. One of its sides of the base makes angle 30° with the PP and nearest corner is 10 mm behind the PP. The station point is 40 mm in front of PP and 70 mm above from GP and containing by central plane. Draw the perspective view.
- [6]

[5]

3. Sketch top view and sectional front view for a double riveted, double strap zig-zag butt joint, where d=12 mm.

OR

In the free hand sketch make complete fit analysis of the following symbols. 60S6/h12 given: F.D. for 'h' and 'S' are 0.00 and -0/42 respectively; ITG for 6 and 12 are 0.019 and 0.30 respectively. [Indicate type of fit, allowance, upper and lower deviation and shaft basis or hole basis system]


- 4. Sketch symbols of followings:
 - i) Pond

- vi) Surface to be obtained without removal of material
- ii) School
- vii) Surface to be coated
- iii) Amplifier
- viii) Fluorescent bulb
- iv) Nipple
- ix) Fillet weld
- v) 90° elbow
- x) Cross

OR

Orthographic projection of an object in third angle projection is shown in figure below. Draw its sectional side view, section A-A.

[5]

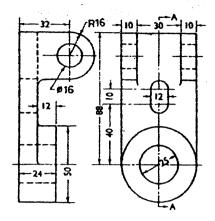

5. Assemble the following detail drawing shown in figure below and draw front view and top view of C-Clamp.

[14]

| OOL:AN INST. | SCREW MASE PASS. | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 | 108 |

Examination Control Division


2070 Bhadra

Fxam.		Regular	
Level	BE	Full Marks	40
Programme	All (Except B.Arch.)	Pass Marks	16
Year / Part	1/11	Time	3 hrs.


[10]

Subject: - Engineering Drawing II (ME451)

- ✓ Candidates are required to give their answers in their own words as far as practicable.
- ✓ Attempt <u>All</u> questions.
- ✓ The figures in the margin indicate Full Marks.
- ✓ Assume suitable data if necessary.
- 1. Orthographic views of an object are shown in figure. Draw its isometric view.

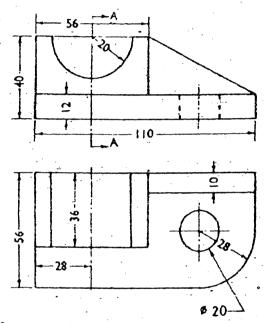

2. Draw oblique drawing of the object shown in figure.

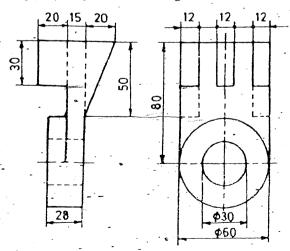

3. Sketch the top view and sectional front view of double row, zig-zag type lap riveted joint. Take diameter of the rivet as 12 mm.

Determine the limits of dimensions and type of fit designated by H7/s6 for the basic size of 100 mm. Take fundamental deviation for H and s respectively as 0.000 and 0.071 mm and international tolerance grades for 7 and 6 as 0.035 and 0.022 mm respectively.

4. Sketch freehand-graphical symbol of

a) Battery


- b)- Plug
- d) DC Generator c) Switch g) Spot Weld h) Cross

- e) Reducer i) External Thread
- f) Bridge
- j) Check Valve

OR

Draw full sectional front view of object shown in figure.

[5]

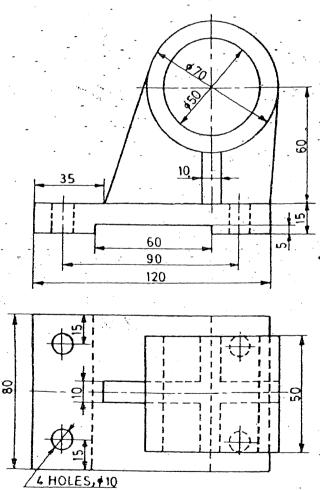

Examination Control Division. 2069 Bhadra

Exam.	Regular (2066 & Later Batch)		
Level	BE	Full Marks	40
Programme	All (except B. Arch.)	Pass Marks	16
Year / Part	I / II	Time	3 hrs.

[10]


[5]

[5]

[5]

Subject: - Engineering Drawing II (ME451)

- Candidates are required to give their answers in their own words as far as practicable.
- ✓ Attempt All questions.
- ✓ The figures in the margin indicate Full Marks.
- ✓ Assume suitable data if necessary.
- 1. Figure below shows the orthographic projections of a guide bracket for a horizontal spindle. Draw its isometric view.

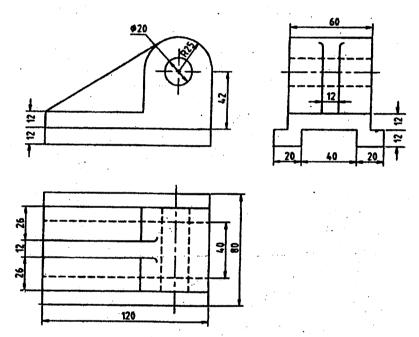


A solid square prism of 30mm side and height 60mm is resting with its base on the ground plane such that its rectangular faces are inclined at 45 degree to the picture plane and the vertical edge nearer to the PP is 15mm behind it. The station point is 60mm in front of PP, 100mm above ground plane and lies in the central plane, which passes from the center of prism. Draw perspective view of the prism.


3. Determine the limits of dimensions for the H6/s7, type of fit and fundamental deviations for the basic size of 50mm, assuming fundamental deviation for "H" and "s" respectively as 0mm above the basic size line and 0.034mm above the basic size line and international tolerance grades for "6" and "7" as 0.016mm and 0.025mm respectively.

OR


Sketch sectional front view and top view of double row, zig-zag type, double strap butt riveted joint.

4. Draw an assembled sectional front view and top view from the following detail drawings shown in figure below. [15]

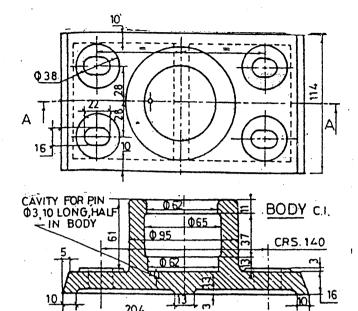

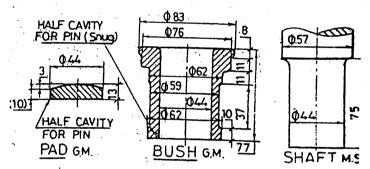

5. Orthographic projection of an object in first angle projection is shown in figure below. Draw its sectional front view section A-A.

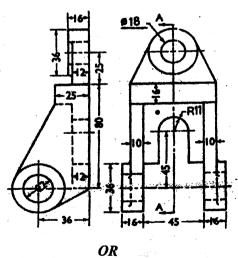

Sketch the symbols for the following.

- a) NPN type transistor
- c) Hill contour
- e) Siren
- g) Elbow 90°
- i) Surface to be obtained by filing
- b) Transformer
- d) Single phase motor
- f) Internal thread
- h) Fillet
- j) Highway bridge

[5]

[5]

Examination Control Division


2068 Bhadra

Exam. Regula			Regular	
į	Level	BE	Full Marks	40
		A 11 (TC	Pass Marks	16
	Year / Part	I/II	Time	3 hrs.

Subject: - Engineering Drawing II

- ✓ Candidates are required to give their answers in their own words as far as practicable.
- ✓ Attempt All questions.
- ✓ The figures in the margin indicate Full Marks.
- ✓ Assume suitable data if necessary.
- 1/ Draw isometric drawing of an object shown in figure below.


[9]

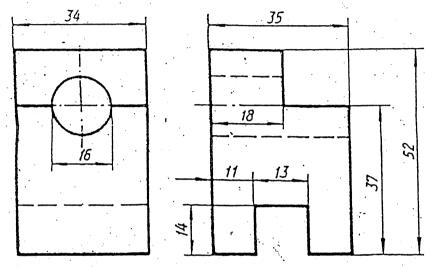


2/ Draw the angular perspective views from given orthographic projections as shown in figure below.

[7]


[5].

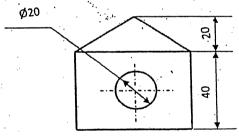



- 3. Draw the standard symbols for the following:
 - a) Square butt
 - c) Surface to obtained by filing
 - e) PNP-type transistor
 - g) Angle
 - i) Lake

- b) Car
- d) Amplifier
- f) AC motor single phase
- h) Antenna
- j) Hill contours

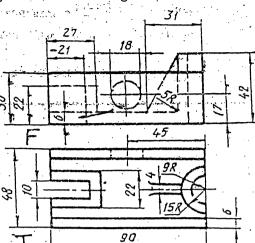


4. Determine the limits of dimensions and type of fit designated by 60 H8/f7, assuming fundamental deviation for H and f respectively as 0 μ m above the basic size line and 25 μ m below the basic size line and the values of international tolerance grades for 8 and 7 as 39 μ m and 25 μ m.

OK

Draw sectional front view and top view of double row, zig-zag type, single strap butt riveted joint.

5 Draw the assembled front view with section from the following detail drawings shown in figure below. [14]

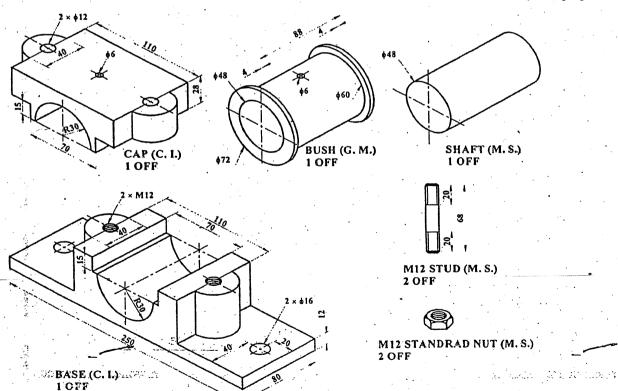

n

[5]

Examination Control Division


2067 Mangsir


Exam:	Regular / Back		
Level	BE	Full Marks	40
Programme	All (Except B.Arch.)	Pass Marks	16
Year / Part	I/II	Time	3 hrs.

Subject: - Engineering Drawing II

- Candidates are required to give their answers in their own words as far as practicable.
- ✓ Attempt <u>All</u> questions.
- ✓ The figures in the margin indicate Full Marks.
- ✓ Necessary figures are attached herewith.
- ✓ Assume suitable data if necessary.
- 1. Orthographic views of an object are shown in figure below. Draw its isometric view.

[10]

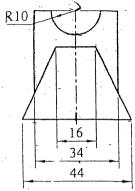

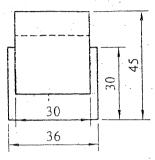

2. A solid box of size $60 \times 45 \times 40$ mm is resting with it's base (60×45) on the ground plane. Draw it's angular perspective view with it's vertical faces equally inclined to the picture plane (PP) and the nearest vertical edge is touching the PP. The station point is 80mm above ground level, 40mm away from the PP and the central plane passes from the vertical edge which is touching the PP.


[5]

3. The production drawing of coupling is shown in figure 3. Draw its assembled half sectional front view and side view.

[15]

4. Sketch revolved section at A-A and removed section at B-B for the link as shown in figure below.

[5]

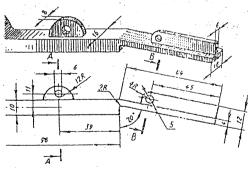

OR

Sketch the graphical symbols for the following.

[5]

- a) End view of external thread
- c) Square section
- e) Thermocouple
- g) Delta connection
- i) V-weld

- b) Capacitor
- d) Resistor
- f) Hill contour
- h) Circuit breaker
- i) Church

5. Determine limits, tolerance, allowance and types of fit designated by 80T8/h5. The value of fundamental deviation given by 'h' is zero and 'T' is -0.024mm. International tolerance grades for 8 and 5 are 0.032mm and 0.014mm respectively. [.5] Sketch the single strap, double row, zig zag butt joint with top view and sectional front [5] Component 2 Component 2 Component 1 Component 1 Assembled Isometric View Half Sectional Pictorial View 36 000 12 **END VIEW** FV Component 1, 1-Off (M.S.) 24 13 **END VIEW** FV

Component 2, 1-Off (M.S.)

All dimensions are in mm

Figure 3

Examination Control Division

2067 Chaitra

Exam.	New Back (2066 Batch Only)		
Level	BE	Full Marks	
Programme	All (Except B.Arch.)	Pass Marks	16
Year / Part	I / II	Time	3 hrs.

[10]

[5]

Subject: - Engineering Drawing II

- ✓ Candidates are required to give their answers in their own words as far as practicable.
- ✓ Attempt All questions.
- ✓ The figures in the margin indicate <u>Full Marks</u>.
- ✓ Necessary figures are attached herewith.
- ✓ Assume suitable data if necessary.
- 1. Orthographic views of an object are shown in Figure 1. Draw its isometric view.
- 2. A solid cube having 50mm sides, is resting with it's flat base on the ground plane. Draw its angular perspective view with it's vertical faces equally inclined to the picture plane (PP) and the nearest vertical edge is touching the PP. The station point is 80mm above ground level, 40mm away from the PP and the central plane passes from the centre of the solid cube.
- 3. The production drawing of coupling is shown in figure 3. Draw its assembled half sectional front view and the side (or end) view. [15]

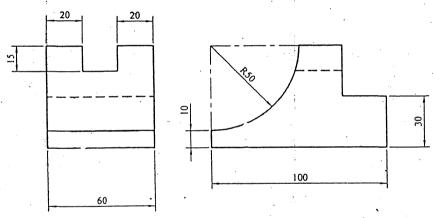


Figure 1

4. Sketch revolved section at A-A and removed section at B-B for the link as shown in figure 4.



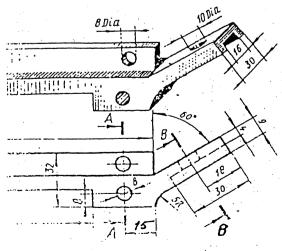


Figure 4

		OA	
	Sketch the symbols for the following:		[5]
	a) Single U Butt weldc) Wall mounted fane) Rectifierg) Capacitori) Embankment	 b) Reducing pressure valve d) Siren f) Antenna h) Multidirectional lay j) Thermocouple 	
5.	fundamental deviation of hole is 0.042	and types of fit designated by 60B7/h8. The mm more than fundamental deviation of shaft. Fare 0.024 mm and 0.021 mm respectively. The 'h' is zero.	[5]
		OR	
	Sketch the triple row, zigzag lap joint w	ith top view and sectional front view. ***	[5]

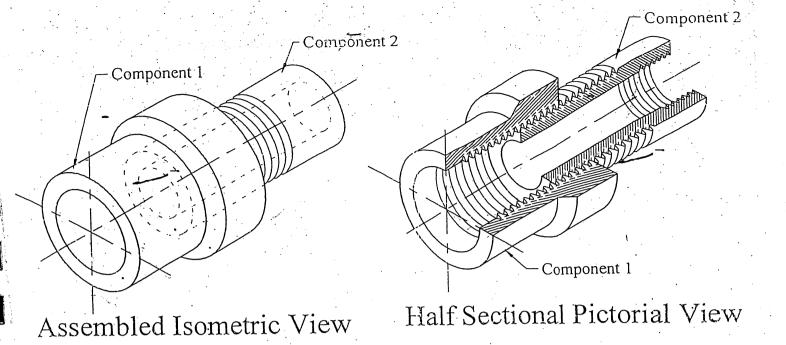


.35 20 12 **END VIEW** Component 1, 1-Off (M.S.)

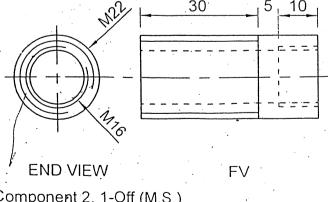

Component 2, 1-Off (M.S.)





All dimensions are in mm


Examination Control Division 2066 Magh

Exam.	Regular/Back		
Level	BE	Full Marks	40
Programme	BCE, B.Agri.	Pass Marks	16
Year / Part	I/II	Time	3 hrs.

Subject: - Engineering Drawing II


- ✓ Candidates are required to give their answers in their own words as far as practicable.
- Attempt <u>All</u> questions.
- The figures in the margin indicate Full Marks.
- √ Dimensions in mm if not specified.
- Assume suitable data if necessary.
- 1. Orthographic views of an object are shown in figure. Draw its isometric view.

[9]

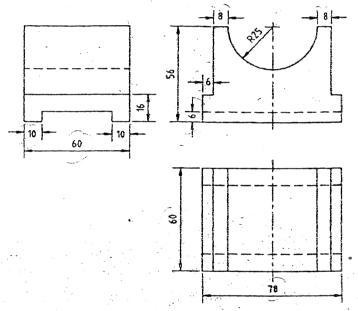


2. Orthographic views of an object are shown in figure. Draw its oblique view.

[6]

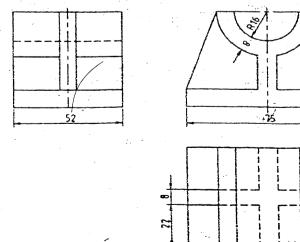

3. The production drawing of plumber block is shown in figure. Draw its assembled half sectional front view.

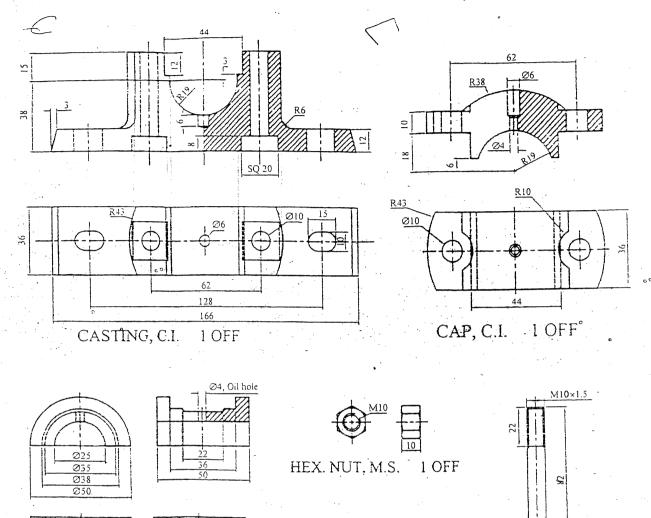

BRASS, G.M. 10FF

LOCK NUT, M.S. 1 OFF

4. Determine the limits of dimensions and type of fit designated by H8/d9 for the basic size of 50mm, assuming fundamental deviation for H and d respectively as 0 μ m and 80 μ m below the basic size line and international tolerance grades for 8 and 9 as 39 μ m and 62 μ m respectively.

OR

Sketch the plan and sectional elevation of double riveted zig-zag lap joint.

- 5. Draw the standard symbols for the followings:
 - a) Seam Weld
 - a) Union
 - e) Channel Section
 - g) Two way Switch
 - i) Depression Contours
- 4) Field Weld
- d) Globe Valve
- f) I Beam.
- h) 3-phase Motor
- ej) Capacitor

[5]

[5]

[15]

**.


Examination Control Division

2066 Magh


Level	-BE	Full Marks-	-40
Programme	BEL, BEX, BCT, BME, BIE	Pass Marks	16
Year / Part	Ι/Π	Time	3 hrs.

Subject: - Engineering Drawing II

- Candidates are required to give their answers in their own words as far as practicable.
- Attempt All questions.
- ✓ The figures in the margin indicate Full Marks.
- ✓ Assume suitable data if necessary.
- 1. Orthographic views of an object are shown in given figure. Draw its oblique view.

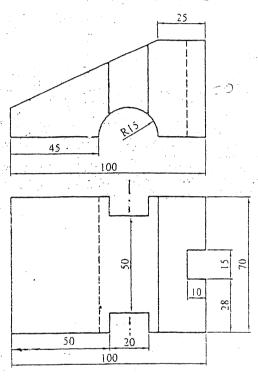


2. Draw the oblique view of object from the given orthographic views as shown in given figure.

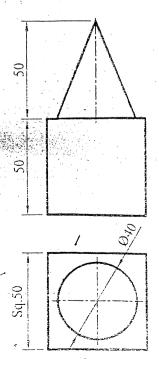

.

[6]

[9]

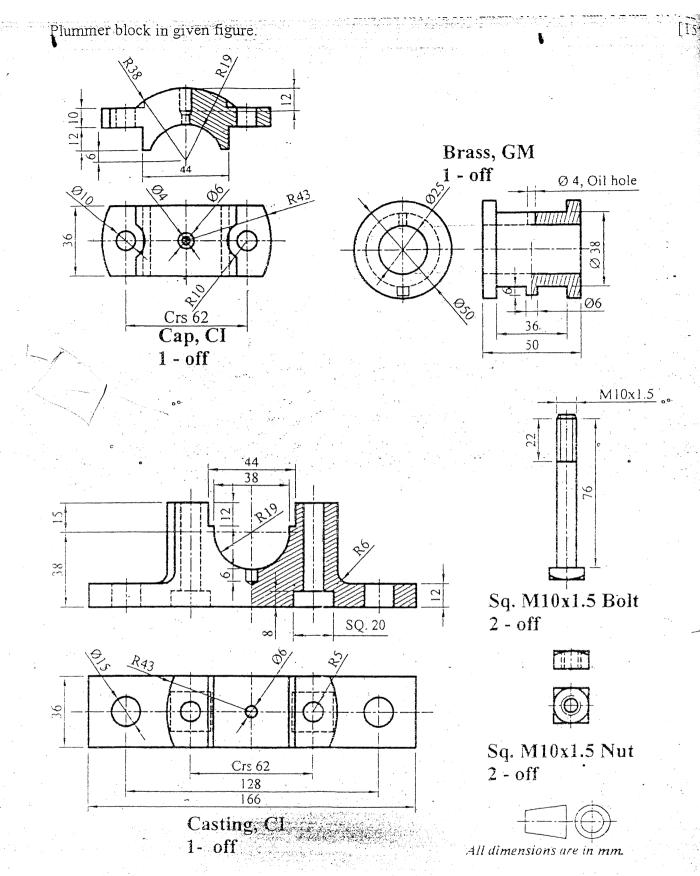

- 4. Determine limits, tolerance, allowance and type of fit designated by 55T8/h5. The value of fundamental deviation 'T' is -0.024mm. International tolerance grades values for 8 and 5 are 0.031mm and 0.013mm respectively. [5]
- 5. Draw the standard symbols for the following:
 - a) Seam Weld
 - c) Incandenscent lamp
 - e) Nipple
 - g) Resistor
 - i) Bell

- b) Cap
- d) Surface produced by casting

[5]

- f) Tubular structural member
- h) Depression counter
- j) End view of external thread